## Technical Bulletin


Bulletin No: TCH-001-051 Effective Date: 3/27/03 Cancels: N/A Page: 1 of 1

## Subject: BA-921 COMPRESSOR UNLOADER CAP REPLACEMENT KIT

Bendix Commercial Vehicle Systems has determined that for some\* BA-921 air compressors, under certain conditions, air pressure can collect above the unloader piston. This prevents the compressor from return to the unloaded mode, causing it to constantly build air. Bendix has determined that this condition is not safety related.

To guard against this occurring, Bendix has developed a replacement unloader cap designed to prevent air being retained above the unloader piston. Bendix recommends that all BA-921 air compressors listed at the bottom of this page have the replacement unloader cap kit installed.

Detroit Diesel Corp. and Caterpillar Inc. will be conducting a service campaign where authorized DDC and CAT service centers will offer unloader cap replacement kits. The kits, Bendix part number 5012771, contain an unloader cap, unloader gasket and spray shield (see Figure 1) along with installation instructions. Replacement should take less than 20 minutes to complete.

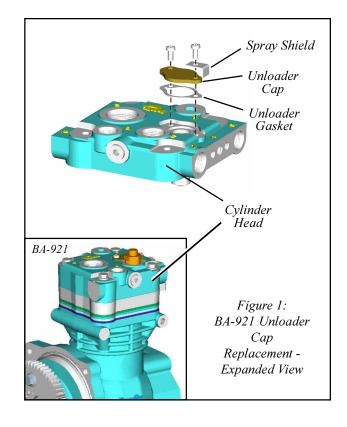

Where a **spray shield** is already installed, the unloader cap upgrade has already been made, and **no action is needed**. Only the BA-921 compressors listed below are part of this service campaign.

For any other technical questions, contact your local DDC or CAT Service Center; Call Bendix at 1-800-AIR BRAKE (1-800-247-2725, option 2); or write to Bendix Commercial Vehicle Systems LLC, 901 Cleveland Street, Elyria, OH 44035, Attention: TechTeam.

## \*Engines and compressor part numbers included in this service campaign:

Engine	Engine	BA-921 Part Numbers	
Manufacturer	Type	Bendix	OE
DDC	Series 60	5010821	DDC 23531315
CAT	C9	5010803	CAT 191-6521
CAT	C15.5, C18	5011427	CAT 223-3637
CAT	C11, C13	5011441	CAT 223-3636

